


RoHS

REV.	EC#	DESCRIPTION	DATE	DRAWING	CHECKED	APPROVED
A0		NEW RELEASE	05/12'19	ZX		WZX

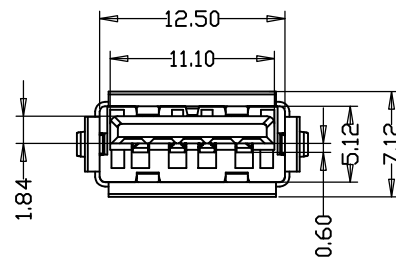

PART No.:

USB SERIES 104010821 PAKING:
PLATING: 1: TRAY
01:G/F+MATTE TIN SERIAL NO.





NOTE:

1. MATERIAL:


- 1.1 INSULATOR:PBT UL 94V-0, BLUE
 - 1.2 CONTACT:COPPER ALLOY
 - 1.3 SHELL:BRASS
2. ELECTRICAL CHARACTERISTICS:
- 2.1 CONTACTRESISTANCE:30mΩ MAXIMUM
 - 2.2 CONTACT CURRENT RATING:1.5A
 - 2.3 DIELECTRIC WITHSTANDING VOLTAGE:100 V R. M. S.
 - 2.4 INSULATION RESISTANCE 100 MEGOHMS MIN
 - 2.5 OPERATING TEMPEROTURE:-40° C ~85° C


3. PLATING

- 3.1 TERMINAL:
30u" MIN NICKEL ALL OVER
80u"MIN Tin ON SOLDER AREA
G/F ON CONTACT AREA
- 3.2 SHELL:50u"MIN. NICEL ALL OVER

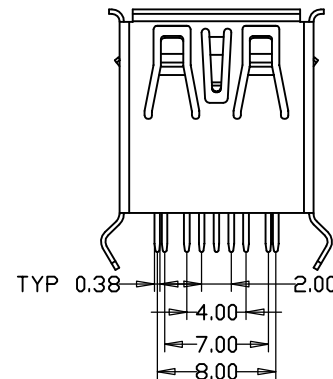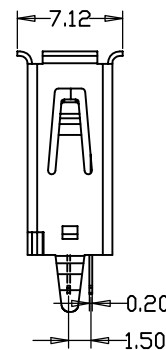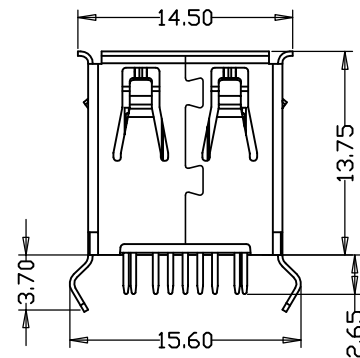

Pin NUMBER	SIGNAL NAME
1	VBUS
2	D-
3	D+
4	GND
5	StdA_SSRX-
6	StdA_SSRX+
7	GND_DRAIN
8	StdA_SSTX-
9	StdA_SSTX+
Shell	Shield

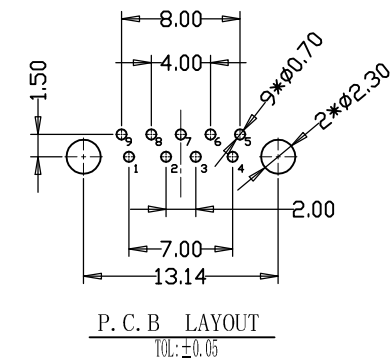

MILLIMETERS	INCH	UNITS MM	 东莞市溪榜电子有限公司 DONG GUAN XI BANG ELECTRONICS CO., LTD.				
X° ± 2'	X° ± 2'	MAT'L	PART NUMBER: XB-104010821		TITLE: USB3.0 AF180度插板13.75有卷边		
.X ±0.30	.XX ±0.012	SEE NOTES	APPD:		DWG NO.: C-104010821-00		
.XX ±0.20	.XXX ±0.008	FINISH	CHKD:				
.XXX±0.10	.XXXX±0.004	SEE NOTES	DR:				
		QTY					
		SEE NOTES					

$\overline{B}$

包装作业图示及说明

- 1: 将成品依次入包装盘内, 依同一个方向放入。
- 2: 包装时, 以图所示。
- 3: 一个包装盘放置100个成品。
- 4: 依次往上叠放30盘, 产品方向保持一致, 上下各放一块硬纸板, 用PE膜将托盘两边缠绕在托盘中间缠绕成#字行 (缠绕3-5圈, 用力要适当)







装盘




料号	规格
104010781	11.1H有卷边
104010791	11.1H无卷边
104010801	11.5H有卷边
104010811	11.5H无卷边
104010821	13.75H有卷边
104010831	13.75H无卷边
104010841	15.0H有卷边
104010851	15.0H无卷边

- 1: 将一扎托盘放入纸箱中
- 2: 纸箱内放2包干燥剂
- 3: 每箱装3000个成品

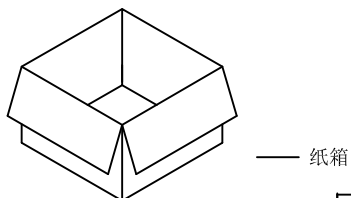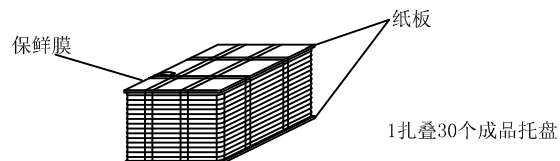

MILLIMETERS	INCH	UNITS MM	 东莞市溪榜电子有限公司 DONG GUAN XI BANG ELECTRONICS CO., LTD.									
$X^{\circ} \pm 2^{\circ}$	$X^{\circ} \pm 2^{\circ}$	MAT'L	PART NUMBER: XB-104010821		TITLE: USB3.0 AF180度插板包装图							
$.X \pm 0.30$	$.XX \pm 0.012$	SEE NOTES										
$.XX \pm 0.20$	$.XXX \pm 0.008$	FINISH	APPD:		DWG NO.: C-104010781-00							
$.XXX \pm 0.10$	$.XXXX \pm 0.004$	SEE NOTES	CHKD:		 <table><tr><th>SCALE</th><th>SHEET</th><th>REV.</th></tr><tr><td>1:1</td><td>2/2</td><td>AO</td></tr></table>		SCALE	SHEET	REV.	1:1	2/2	AO
SCALE	SHEET	REV.										
1:1	2/2	AO										
		QTY	DR:									
		SEE NOTES										

- 1: 用透明胶将纸箱封实
- 2: 将标签贴在纸箱侧上方

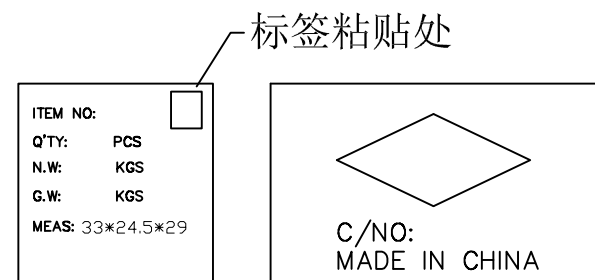

备 注 (REMARK)

- 1: 装不满一个外箱的, 用填充物填满未满空间
或将纸箱割小至刚好装下
- 2: 在搬运过程中要轻拿轻放
- 3: 在运输过程中不可堆放过多, 不可有重压现象。